


Lewmar

Three speed winches

Model 48

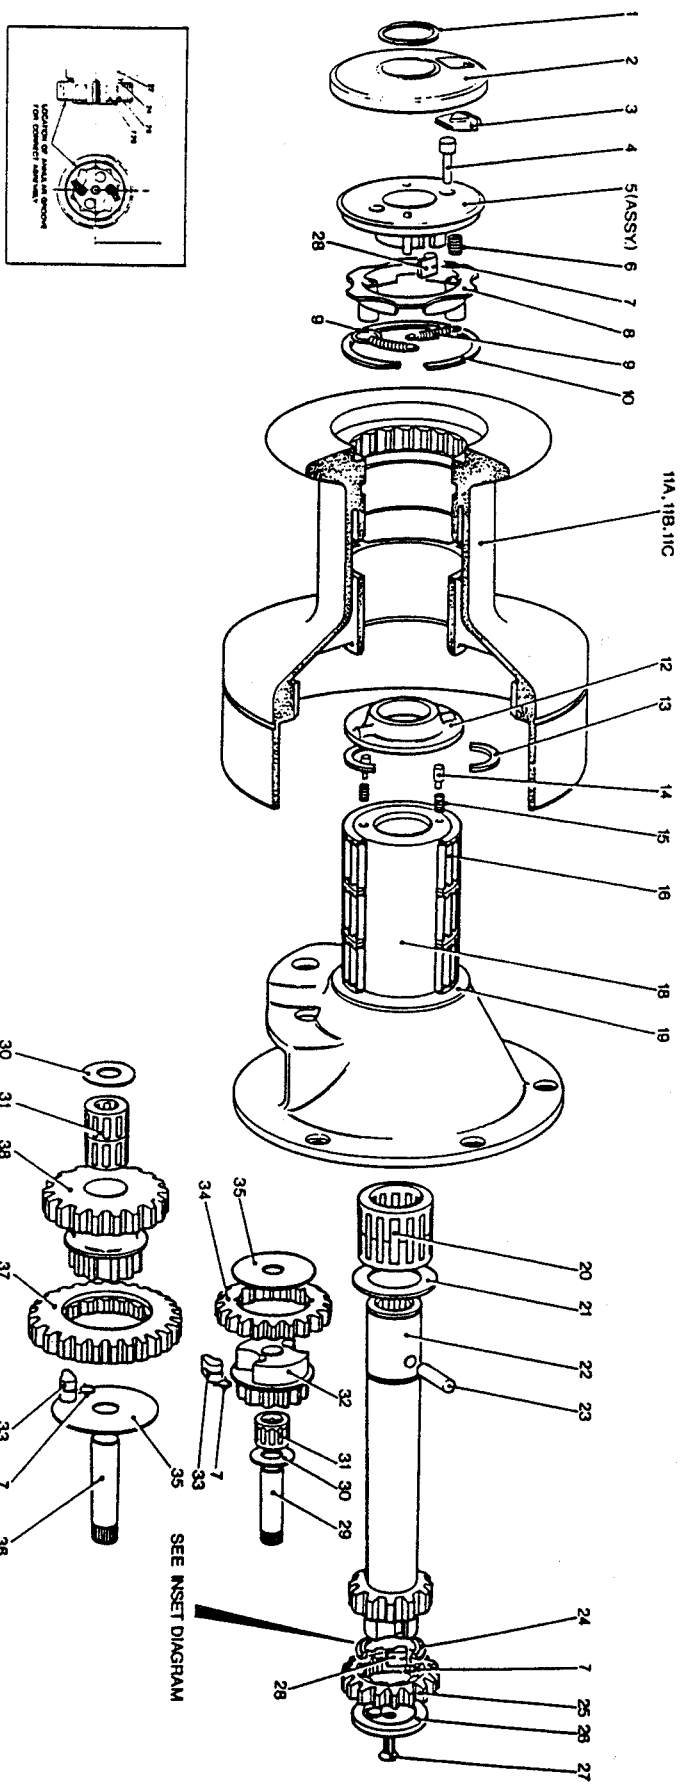

Parts List

Item Number	Part Number	Description	No. OH
1	B2075	Circello, Spirolox	1
2	15048108	Top Cap Cover	1
3	15044114	Push Button	1
4	15044111	Plunger	1
5	15044104	Top Cap Assembly	1
6	15044112	Spring	1
7	1260/7	Pawl Spring	8
8	15044106	Closing Ring	2
9	15044113	Spring	2
10	B2083	Circello	1
11A	15048102	Drum, Bronze	1
11B	15048202	Drum, Alloy	1
11C	15048302	Drum, Stainless Steel	1
12	15044106	Clutch Plate	1
13	15044118	Collar	2
14	1300/24	Plunger	2
15	1300/20	Spring	2
16	1301/SA3	Cage Assembly	3
18	15048101	Centre Stem	1
18	15044116	Washer	1
20	1264/SA2	Cage Assembly	1
21	1300/21	Washer	1
22	15048103	Spindle	1
23	15044119	Drive Pin	1
24	15025107	Spacer	1
25	15048104	Ratchet Gear	1
26	15018107	Spindle End Cap	1
27	B0515	Counterbore Screw 3/8" U.N.C.	1
28	1260/8	Pawl	4
29	1300/10	Spindle	1
30	1300/22	Washer	2
31	1300/8	Pawl Gear	3
32	1300/SA2	Cage Assembly	1
33	1264/8	Pawl	4
34	1300/7	Ratchet Gear	2
35	1264/7	Washer	2
36	1300/9	Spindle	1
37	1300/6	Ratchet Gear	1
38	1300/6	Pawl Gear	1

with groove provided.
 Z1 Engage two springs (9) with pillars provided on closing ring (8).
 AZ Check top cap mechanism for correct operation, as prescribed in point (F), Oil lightly.
 B2 Reassemble and check winch as points (N,P).
 CZ If winch fails to perform correctly, re-check servicing technique or contact your nearest Lewmar service point.

Spare Parts Kits
 Model 48
 Cat No 19748400

Contents
 4 x Pawl Pt. No 1260/8
 8 x Spring Pt No 1260/7
 4 x Pawl Pt No 1264/8
 2 x Washer Pt No 1300/22
 2 x Washer Pt No 1264/7
 2 x Plunger Pt No 1300/24
 2 x Spring 1300/20
 1 x Plunger Pt No 15044111
 1 x Spring Pt No 15044112
 1 x Washer Pt No 15025107
 1 x Circello Pt No B2083
 1 x Pin Pt No B2075
 2 x Spring Pt No 15044113